


Akupack je určen výhradně k dataloggerům: **U0110M, U0121M, U0141M, U0843M, U2422, U3120M, U3121M, U3430, U3631M, U4440, U4440M, U5841M, U6841M, U7844M, U8410, U8410M**

UPOZORNĚNÍ - výměnu smí provádět pouze kvalifikovaný servisní technik
- před výměnou si podrobně přečtěte tento postup
- pro doplnění zde uvedených informací použijte manuálů a dalších dokumentů, které jsou k dispozici v sekci *Ke stažení* u konkrétního přístroje na www.cometsystem.cz

- vypněte přístroj:
 - stiskněte dlouze dolní tlačítko a poté, co se rozsvítí řádek s položkami menu, tlačítko uvolněte
 - krátce stiskněte horní tlačítko
 - opakovaným krátkým stiskem horního tlačítka zvolte symbol **OFF**
 - zmáčknutím dolního tlačítka přístroj vypněte
- odšroubujte zadní díl přístroje, ve kterém je umístěn akumulátor (použijte šroubovák TORX T10)
- odpojte starý akupack od přístroje
- k přístroji připojte USB nabíječku a **vyčkejte**, až na displeji bude **trvale** svítit symbol plně nabitě baterie (viz obr.)
- vybalte nový akupack A8205, zkontrolujte a případně upravte polohu těsnění v drážce
- porovnejte údaj o kapacitě starého a nového akupacku, pokud se liší, kontaktujte výrobce nebo distributora zařízení
- znovu ověřte, zda na displeji svítí symbol plně nabitě baterie a **teprve poté** připojte nový akupack k přístroji - **! nedodržení tohoto kroku může vést ke zničení nového akupacku !**
- přístroj sestavte (opatrně dotáhněte šrouby)
- přístroj nechte nabít do plného stavu (symbol plně nabitě baterie musí **trvale** svítit):
 - při nabíjení musí být přístroj umístěn ve vnitřních prostorách s vlhkostí max. 85%.
 - nabíjení bude probíhat pouze při vnitřní teplotě přístroje v rozmezí 0 až 40 °C.
- zapněte přístroj

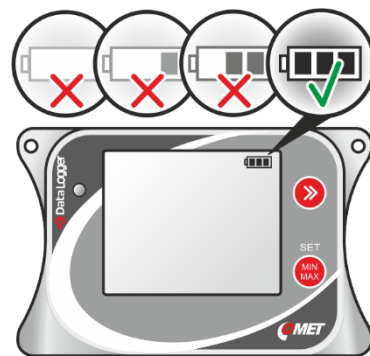

The accupack is designed exclusively for dataloggers: **U0110M, U0121M, U0141M, U0843M, U2422, U3120M, U3121M, U3430, U3631M, U4440, U4440M, U5841M, U6841M, U7844M, U8410, U8410M**

WARNING - Replacement may only be carried out by a qualified service technician
- Read this procedure in detail before you replace it
- To add any additional information provided here, use manuals and other documents available in the *Downloads* section for a particular device at www.cometsystem.com

- Turn off the device:
 - press and hold down the lower button and release the button when the menu item bar lights up
 - briefly press the upper button
 - press the upper button briefly again to select **OFF**
 - press the lower button to turn off the device
- unscrew the rear of the device where the accu is located (use the TORX T10 screwdriver)
- disconnect the old accupack from the device
- connect the USB charger to the device, and **wait until the full battery symbol will be permanently lit** (see fig.)
- unpack the new A8205 accupack, check and, if necessary, adjust the position of the seal in the groove
- compare the nominal capacity data of the old and new accupack, if they differ, contact the manufacturer or distributor of the device
- again check that the fully charged battery symbol is on the display and **then** connect the new accupack to the device - **! failure to observe this step can lead to the destruction of a new accupack !**
- assemble the device (the screws tighten gently)
- charge the unit fully (full-battery symbol must be **permanently lit**):
 - When charging, the device must be installed indoors with a maximum humidity of 85%, at an indoor temperature ranging between 0°C and +40°C.
- Turn device ON

